

## MODEL NO.

NSX-AJ50 / AJ54 / BL44 / BL54 / BL56 / DR6  
SZ40 / SZ42 / SZ50 / SZ51 / SZ52 / SZ60

## SUBJECT

Notes on replacing μ-COM

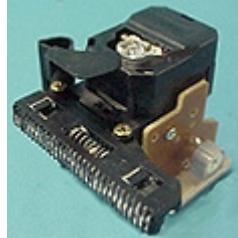
REF.No. :G - A0 - 075 - E0

DATE :25. SEP. 2000

## &lt;CONTENTS&gt;

The CD mechanisms mounted on the models above are broadly divided into four different types.  
μ-COM used on the CD mechanisms are not compatible with each other on different types.

When replacing μ-COM, be sure to identify a CD mechanism with reference to the table below:  
Determine a type of CD mechanism by a Pick up, amplifier type, servo type, and presence/absence of RDS.

AMP	SERVO (IC)	RDS	μ-COM Version	KSS-213F	KSM-880
					
Bi-AMP.	DIGITAL SERVO (LA9235M) (LC78641E)	No	OLD		8A-NF8-610-010 LC866548B-5N82
			NEW	8A-NF8-625-030 LC866548W-5S32	8A-NF8-612-010 LC866548V-5P03
		Yes	OLD		8A-NF8-612-110 LC866548V-5P40
			NEW		8A-NF8-611-010 LC866560W-5P19
	ANALOG SERVO	No	NEW		8A-NF8-611-110 LC866560W-5P41
		Yes	NEW		
2ch AMP.	(LA9241M) (LC78622E)	No	NEW	8A-NF8-613-010 LC866548V-5P87	
		Yes	NEW	8A-NF8-614-010 LC866560W-5P89	
		No	NEW	8A-NF8-620-010 LC866548V-5R49	
		Yes	NEW	8A-NF8-621-010 LC866560W-5R50	

## &lt;NOTE&gt;

If a μ-COM of an earlier version is mounted, replace it with one of a new version.

Ref.	Parts Code	Description	Remarks
IC201	8A-NF8-611-110	C-IC,LC866560W-5P41	AZG-1 ZD8
IC201	8A-NF8-612-110	C-IC,LC866548V-5P40	AZG-1 ZD8
IC201	8A-NF8-613-010	C-IC,LC866548V-5P87	AZG-1 ZA3 / A4 / A8
IC201	8A-NF8-614-010	C-IC,LC866560W-5P89	AZG-1 ZA3 / A4 / A8
IC201	8A-NF8-620-010	C-IC,LC866548V-5R49	AZG-1 ZA3 / A4 / A8
IC201	8A-NF8-621-010	C-IC,LC866560W-5R50	AZG-1 ZA3 / A4 / A8
IC201	8A-NF8-625-030	C-IC,LC866548W-5S32	AZG-1 ZD3 / D4

G	R	Code No.	Access Code	Modified Ser. No.	Parts Schedule
-	-	-	-	-	NOV.2000